

Manhole Inspection Summary

Manhole # S05Q__008MH

Printed On: 6/24/2010

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **05Q** Node: **008** Status: **Found**

Insp Date: **3/11/09 9:10 AM**

Incomplete Comments

Crew: **SD,WJ**
Inspector: **Lamont**
Firm: **URS**

Location Address: **PARKTON ST**

Cross Street: **YALE AVE**

Manhole Type: **Inline** Location: **Easement / Right of Way**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **30** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☒ **Roots** ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Deteriorated ☒ **Leaks** ☒ **Debris**

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **9** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **8** (ft.) ☐ Active Surcharge Present


Location View



Top View




Defect 2

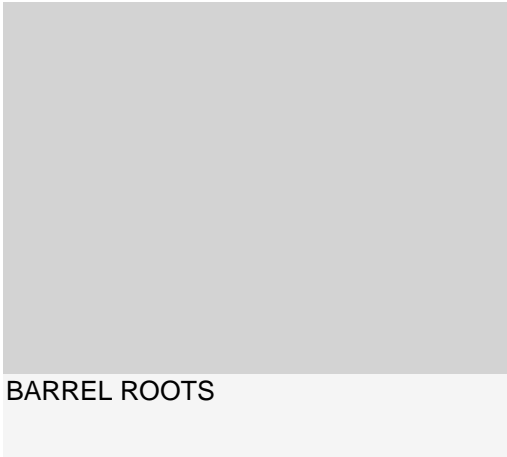


BARREL ROOTS

Defect 6

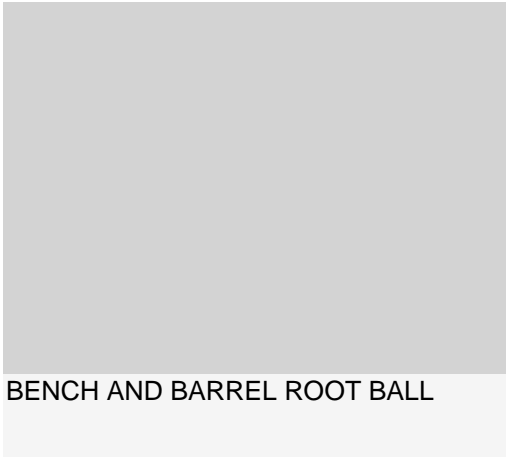


BENCH AND BARREL ROOT BALL

Defect 5

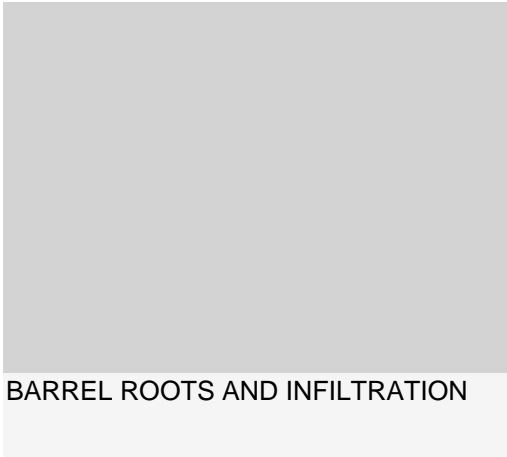


BARREL ROOTS AND INFILTRATION

Defect 3

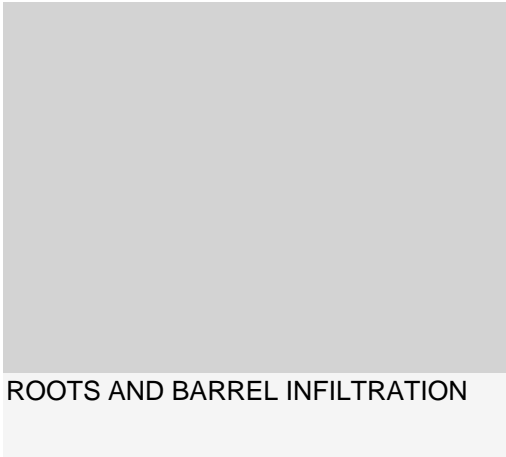


ROOTS AND BARREL INFILTRATION

Defect 1



ROOTS AND SOIL INFILTRATION
PILING ON BENCH.

Defect 4



EVIDENCE OF SURCHARGE WITH
BENCH AND BARREL INFILTRATION

Manhole Inspection Summary

Manhole # S05Q__008MH

Printed On: 6/24/2010

Page 4 of 5

15 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



PIPE SEAL ROOTS AND INFILTRATION

Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **16.40** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer
Pipe In @ 5 O'Clock

5 O'Clock Inflow



PIPE SEAL ROOTS AND INFILTRATION

Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **16.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Weeper** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**



☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 8 O'Clock

8 O'Clock Inflow

Drop In @ 8 O'Clock

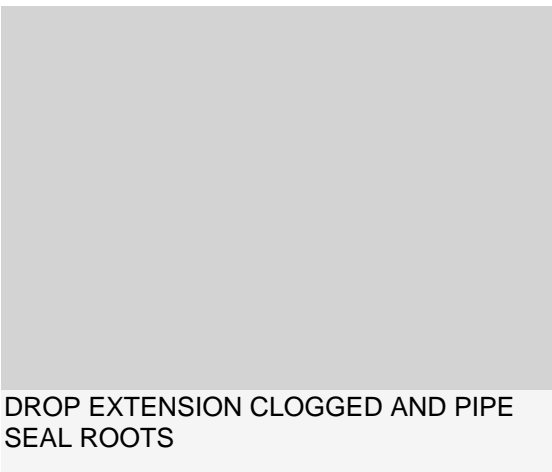

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.40** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection